3M Scotch-WeldPotting Compound/Adhesive DP-270 Clear and Black

Technical Data June, 2002

Product Description

3MTM Scotch-WeldTM Adhesive DP-270 (or Scotch-Weld Adhesive 270 B/A) is a two-part, low viscosity epoxy resin system designed primarily for potting, sealing, and encapsulation of many electronic components. It is available in clear or black. Scotch-Weld DP-270 adhesive is noncorrosive to copper and offers good thermal shock resistance and excellent retention of electrical insulation properties under high humidity conditions.

Scotch-Weld DP-270 adhesive has a work life of approximately 70 minutes, a tack-free time of about 3 hours and is fully cured after 48 hours at 73°F (23°C). This product produces no exotherm in 5-10 gram masses and a very slight exotherm in larger masses.

The Scotch-Weld DP-270 adhesive system is ideal for the potting and encapsulation of many heat sensitive or delicate components such as glass diodes and sensors as well as for transformers, coils, chokes, relays, etc. It is available in the convenient 3MTM Scotch-WeldTM EPXTM Applicator System for multi-station usage and in bulk containers for larger volume applications.

Available in larger containers as 3MTM Scotch-WeldTM Adhesive 270 B/A.

Features

· Clear or Black

- Excellent Electrical Properties
- · Good Thermal Shock Resistance
- Noncorrosive to Copper
- Meets UL 94 HB (File No. E61941)
- Negligible Exotherm

Long Worklife

Typical Uncured Properties

Note: The following technical information and data should be considered representative or typical only and should not be used for specification purposes.

Color:	Clear or Black	
Base Resin:	Epoxy/amine	
Mix Ratio:	1:1 by volume (1:0.85 B:A by weight)	
Net Weight: Lbs./Gal.	Base 9.6 - 9.8 Accelerator 8.0 - 8.2	
Worklife:	60-70 minutes @ 23°C (73°F)	
Viscosity: @ 23°C (73°F)	Base 7000 - 16,000 cps Accelerator 6000 - 12,000 cps	

$\textbf{Scotch-Weld}^{\text{\tiny TM}}$

Potting Compound/Adhesive

DP-270 Clear and Black

Typical Cured Properties

Note: The following technical information and data should be considered representative or typical only and should not be used for specification purposes.


Physical:		
Color	Clear or Black	
Refractive Index @ 25°C (77°C)	Clear 1.656	
Cure Shrinkage	.08%	
Shore D Hardness (ASTM D-2240)	83	
Tack-free Time	Approx. 3 hrs. @ 23°C (73°F)	
UL Rating	94 HB (File No. E61941)	
Cure Time	48 hrs. @ 23°C (73°F)	
Thermal:		
Weight Loss by TGA (in air)	1% @ 122°C (252°F) 5% @ 175°C (347°F) 10% @ 210°C (410°F)	
Thermal Coefficient of Expansion by TMA Below Tg Above Tg	80 x 10 ⁻⁶ units/unit/°C 5-30°C range (10-86°F range) 180 x 10 ⁻⁶ units/unit/°C	
	60-125°C range (140-257°F)	
Glass Transition Temperature by DSC Onset Mid-Point	43°C (109°F) 49°C (120°F)	
Thermal Conductivity (@ 110°F on .250" samples) BTU - ft./ft.² - hr °F Cal./sec cm - °C Watt/m - °C	.103 .426 x 10 ³ .177	
Thermal Shock Resistance Potted Washer Olyphant Test 3M Test Method C-3174 +100°C (air) to -50°C (liquid)	Pass 5 Cycles without cracking	
Electrical:		
Dielectric Constant (ASTM D-150)	3.5 @ 1 KHz @ 23°C (73°F)	
Dissipation Factor (ASTM D-150)	.018 @ 1 KHz @ 23°C (73°F)	
Dielectric Strength (ASTM D-149)	850 volts/mil	
Volume Resistivity (ASTM D-257)	4.1 x 10 ¹⁴ ohm-cm	
Insulation Resistance (.8 mm/.8 mm comb pattern on FR-4) 60°C/96% R.H./100 volts d.c.) Initial	3 x 10 ¹³ ohms	
1000 hrs.	2 x 10 ¹¹ ohms	


$\textbf{Scotch-Weld}^{\text{\tiny TM}}$

Potting Compound/Adhesive


DP-270 Clear and Black

Additional Electrical Properties for Scotch-Weld DP-270

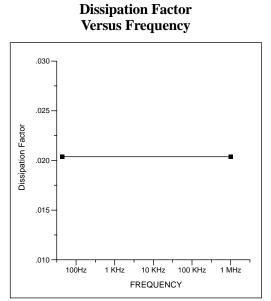

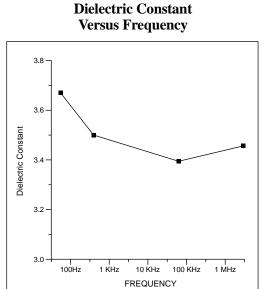

Insulation Resistance .8 mm/.8 mm Comb Pattern 60°C (140°F)/95% RH/100 V d.c.

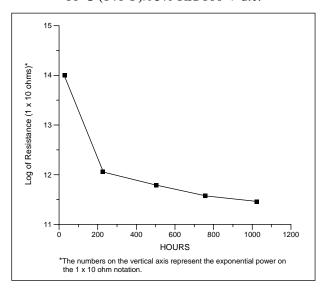

Scotch-Weld[™]

Potting Compound/Adhesive

DP-270 Clear and Black

Typical C`ured Properties (continued)

Note: The following technical information and data should be considered representative or typical only and should not be used for specification purposes.

Corrosion:

Per ASTM D-3492

(35°C/95°F/96% R.H./45V d.c./15 days)

Pass - No copper corrosion

Per 3M Test Method C-708

(45°C/113°F/96% R.H./250V d.c./5 days) (65°C/149°F/96% R.H./250V d.c./4 days) Pass - No copper corrosion Pass - No copper corrosion

Per Mil S-46163

(10 days/50% R.H./23°C/73°F)

Pass - No aluminum, brass or steel

discoloration or corrosion

Solvent Resistance:

(Visual check after immersion in specified solvent at 23°C (73°F)

	1 Hour	1 Month
Acetone	В	С
Isopropyl Alcohol	Α	В
Freon TF	Α	Α
Freon TMC	В	С
1,1,1-Trichloroethane	Α	С
RMA Flux	Α	В

Key: A - Unaffected B - Slight Attack

C - Moderate/Severe Attack

Handling/Curing Information

Directions for use.

- 1. For high strength structural bonds, paint, oxide films, oils, dust, mold release agents and all other surface contaminants must be completely removed. However, the amount of surface preparation directly depends on the required bond strength and the environmental aging resistance desired by user. For specific surface preparations on common substrates, see the following section on Surface Preparation.
- 2. These products consist of two parts.

Mixing

For Duo-Pak Cartridges

3MTM Scotch-WeldTM Adhesive DP-270 Clear and Black are supplied in a dual syringe plastic Duo-Pak cartridge as part of the 3MTM Scotch-WeldTM EPXTM Applicator systems. To use, simply insert the Duo-Pak cartridge into the EPX applicator and start the plunger into the cylinders using light pressure on the trigger. Next, remove the Duo-Pak cartridge cap and expel a small amount of adhesive to be sure both sides of the Duo-Pak cartridge are flowing evenly and freely. If mixing of Part A and Part B is desired, attach the EPX mixing nozzle to the Duo-Pak cartridge and begin dispensing the adhesive. For hand mixing, expel the desired amount of material and mix thoroughly to obtain a uniform color.

$\textbf{Scotch-Weld}^{\text{\tiny TM}}$

Potting Compound/Adhesive

DP-270 Clear and Black

Handling/Curing Information (continued)

For Bulk Containers

Mix thoroughly by weight or volume in the proportions specified in the Typical Uncured Properties Section. Mix thoroughly to obtain a uniform color.

- 3. For maximum bond strength apply product evenly to both surfaces to be joined.
- 4. Application to the substrates should be made within 70 minutes. Larger quantities and/or higher temperatures will reduce this working time.
- 5. Join the adhesive coated surfaces and allow to cure at 60°F (16°C) or above until firm. Heat up to 200°F (93°C) will speed curing.
- 6. The following times and temperatures will result in a full cure of these products.

23°C (73°F)	48 Hours
50°C (122°F)	4 Hours
80°C (176°F)	60 Minutes
100°C (212°F)	30 Minutes

- 7. Keep parts from moving during cure. Contact pressure necessary. Maximum shear strength is obtained with a 3-5 mil bond line.
- 8. Excess uncured adhesive can be cleaned up with ketone type solvents*.

*Note: When using solvents, extinguish all ignition sources and follow the manufacturer's precautions and directions for use.

Adhesion Coverage: A 0.005 in. thick bondline will yield a coverage of 320 sq. ft./gallon

Application and Equipment Suggestions

These products may be applied by spatula, trowel or flow equipment.

Two part mixing/proportioning/dispensing equipment is available for intermittent or production line use. These systems are ideal because of their variable shot size and flow rate characteristics and are adaptable to most applications.

Scotch-Weld[™]

Potting Compound/Adhesive

DP-270 Clear and Black

Surface Preparation

For high strength structural bonds, paint, oxide films, oils, dust, mold release agents and all other surface contaminants must be completely removed. However, the amount of surface preparation directly depends on the required bond strength and the environmental aging resistance desired by user.

The following cleaning methods are suggested for common surfaces:

Steel

- 1. Wipe free of dust with oil-free solvent such as acetone, isopropyl or alcohol solvents.*
- 2. Sandblast or abrade using clean fine grit abrasives.
- 3. Wipe again with solvent to remove loose particles.
- 4. If a primer is used, it should be applied within 4 hours after surface preparation. If 3MTM Scotch-WeldTM Structural Primer 1945 B/A is used, apply a thin coating (0.5 mils) on the metal surfaces to be bonded, air dry for 10 minutes, then cure for 30 minutes at 180°F (82°C) prior to bonding.

Aluminum

- 1. Vapor Degrease: Perchloroethylene condensing vapors for 5 10 minutes.
- 2. Alkaline Degrease: Oakite 164 solution (9-11 oz./gallon water) at $190^{\circ}F \pm 10^{\circ}F$ (88°C \pm 5°C) for 10-20 minutes. Rinse immediately in large quantities of cold running water.
- 3. Acid Etch: Place panels in the following solution for 10 minutes at $150^{\circ}F \pm 5^{\circ}F$ ($66^{\circ}C \pm 2^{\circ}C$).

Sodium Dichromate 4.1 - 4.9 oz./gallon Sulfuric Acid, 66°Be 38.5 - 41.5 oz./gallon 2024-T3 aluminum (dissolved) 0.2 oz./gallon minimum

Tap Water as needed to balance

- 4. Rinse: Rinse panels in clear running tap water.
- 5. Dry: Air dry 15 minutes; force dry 10 minutes at $150^{\circ}F \pm 10^{\circ}F$ ($66^{\circ}C \pm 5^{\circ}C$).
- 6. If primer is to be used, it should be applied within 4 hours after surface preparation.

Plastics/Rubber

- 1. Wipe with isopropyl alcohol.*
- 2. Abrade using fine grit abrasives.
- 3. Wipe with isopropyl alcohol.*

Glass

- 1. Solvent wipe surface using acetone or MEK.*
- 2. Apply a thin coating (0.0001 in. or less) of 3MTM Scotch-WeldTM Primer EC-3901 to the glass surfaces to be bonded and allow the primer to dry 60 minutes before bonding.

*Note: When using solvents, extinguish all ignition sources and follow the manufacturer's precautions and directions for use.

$Scotch-Weld^{TM}$

Potting Compound/Adhesive

DP-270 Clear and Black

Typical Adhesive Performance Characteristics

Note: The following technical information and data should be considered representative or typical only and should not be used for specification purposes.

Although 3MTM Scotch-WeldTM Adhesive DP-270 and 270 B/A can be used for many potting and encapsulation applications, they can also be used as adhesives. The following shows typical shear and peel values determined on several common substrates:

Overlap Shear Adhesion (ASTM D-1002-72)

	Curing Conditions 7 days/73°F (23°C)	
Alum.Alum. (etched)	@-67°F (-55°C) @73°F (23°C)	1200-1250 psi 2450-2500 psi
	@180°F (82°C)	300-350 psi
FR-4/FR-4 (MEK Wiped)	@73°F (23°C)	1750-1800 psi
Copper/Copper (MEK Wiped)	@73°F (23°C)	1700-1750 psi
90° T-Peel Adhesion (ASTM D-1876-6	51T)	
Alum./Alum. (etched)	@73°F (23°C)	< 2 piw
Compression strength (ASTM D-695-6	(T8T)	
Scotch-Weld Adhesive DP-270 Clear and Black	@73°F (23°C)	8100 psi

Storage and Shelf Life

Storage: Store product at 60-80°F (16-27°C) for maximum storage life.

Shelf Life: These products when stored in original, unopened container have a shelf life of 2 years for bulk containers and 15 months in Duo-Pak containers.

Scotch-Weld[™] **Potting Compound/Adhesive**

DP-270 Clear and Black

Precautionary Information

Refer to Product Label and Material Safety Data Sheet for health and safety information before using this product. For additional health and safety information, call 1-800-364-3577 or (651) 737-6501.

For Additional Information

To request additional product information or to arrange for sales assistance, call toll free 1-800-362-3550 or visit www.3M.com/adhesives. Address correspondence to: 3M Engineered Adhesives Division, 3M Center, Building 220-7E-01, St. Paul, MN 55144-1000. Our fax number is 651-733-9175. In Canada, phone: 1-800-364-3577. In Puerto Rico, phone: 1-787-750-3000. In Mexico, phone: 52-70-04-00.

Important Notice

3M MAKES NO WARRANTIES, EXPRESS OR IMPLIED, INCLUDING, BUT NOT LIMITED TO, ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. User is responsible for determining whether the 3M product is fit for a particular purpose and suitable for user's method of application. Please remember that many factors can affect the use and performance of a 3M product in a particular application. The materials to be bonded with the product, the surface preparation of those materials, the product selected for use, the conditions in which the product is used, and the time and environmental conditions in which the product is expected to perform are among the many factors that can affect the use and performance of a 3M product. Given the variety of factors that can affect the use and performance of a 3M product, some of which are uniquely within the user's knowledge and control, it is essential that the user evaluate the 3M product to determine whether it is fit for a particular purpose and suitable for the user's method of application.

Limitation of Remedies and Liability

If the 3M product is proved to be defective, THE EXCLUSIVE REMEDY, AT 3M'S OPTION, SHALL BE TO REFUND THE PURCHASE PRICE OF OR TO REPAIR OR REPLACE THE DEFECTIVE 3M PRODUCT. 3M shall not otherwise be liable for loss or damages, whether direct, indirect, special, incidental, or consequential, regardless of the legal theory asserted, including, but not limited to, contract, negligence, warranty, or strict liability.



This Engineered Adhesives Division product was manufactured under a 3M quality system registered to ISO 9002 standards.





